




PROOFEX
WATERPROOFING+

Advanced Waterproofing Solution...

Waterproofing Treatment done at Villa # 572 -
Mayfair BHEL, Kondakal, Hyderabad



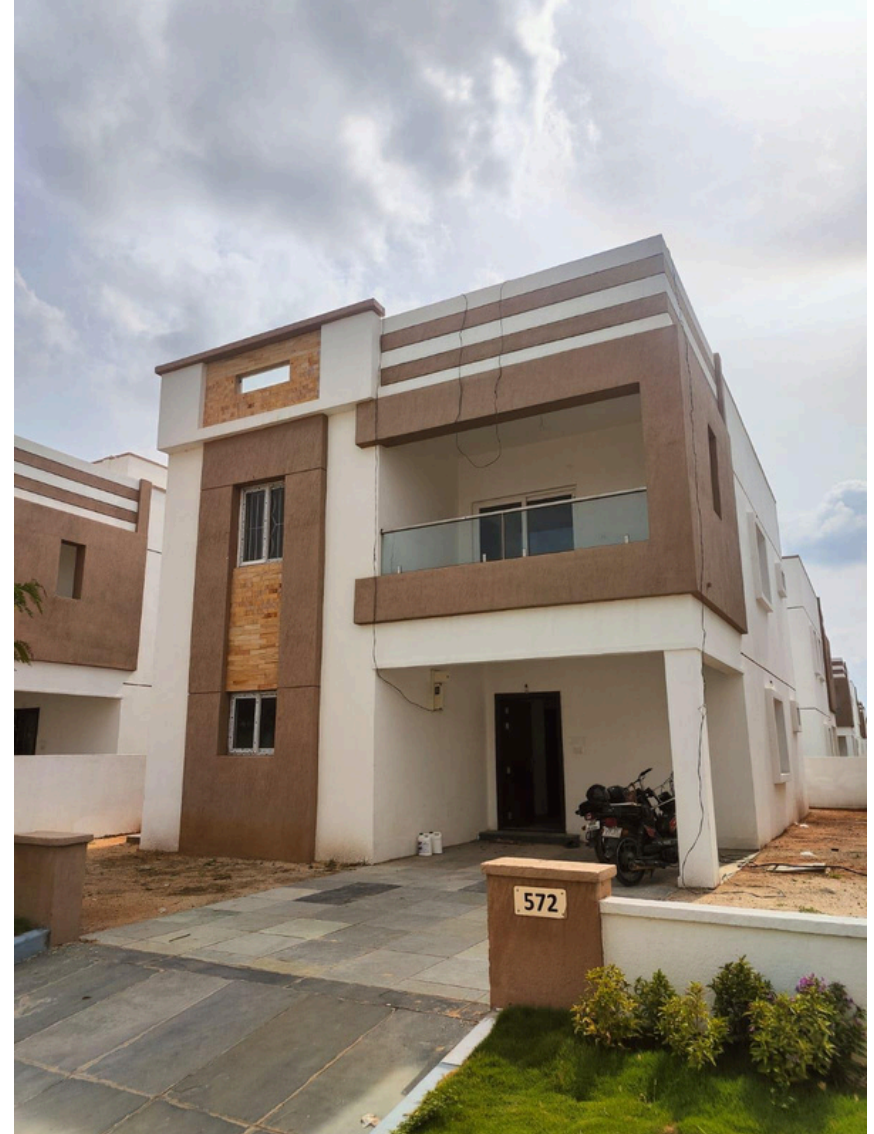

Diagnosis Report:

Main Terrace Floor and Parapet Wall Area: We Found Hair line and lengthy Cracks on the Main Terrace floor area and even Parapet wall area.

Due to that Dampness found on the Ceiling area and Steps wall area.

External Wall Area: We observed that there are cracks on the external walls that is visible only on the Stairs head room (All Four Sides-Slab and Brick junction area) because of smooth plaster, but not seen on other areas because of textured paint.

Duct Area: We Found cracks on ducts inside wall area and found DPC not done before brick work even plaster is having lot of cavities. not done properly on the Plinth beam and Brick Junction area.

Toilet Floor Joints: Due to existing Paper joints there is a chances of leakages in near future.

List of Work carried out:

- > Cleaning the Terrace Floor with High Pressure Jet Wash.
- > Crack filling treatment to the terrace, head terrace, and Parapet wall area.
- > > > Application of Penetrative cum bonding chemical as primer application to the terrace area.
- > Application of High build fiber reinforced seamless waterproof render coating in two coats to the terrace area.
- External wall crack filling treatment to the Stairs head Room slab and brick junction area.
- Application of Elastomeric & decorative acrylic waterproofing cum anticarbonation coating to the Head room external wall area in two coats.
- Taking out the duct ground soil area up to the Plinth beam level, providing and application of hydrophobic cement mortar treatment to the base and plaster the surface.
- Crack filling Treatment to the duct area, then application of fiber reinforced waterproof coating in two coats.
- Cutting the tile joint with 2-5 mm groove with grinder machine, grouted with three component epoxy adhesive into tile and corner joints area























*Waterproofing Treatment done at Villa # 572 -Mayfair BHEL, Kondakal, Hyderabad
After Treatment: Main Terrace Area*



Contact : Devashish Nayak
96666 39565



**Water Continues to Damage or Completely Destroy more Buildings and structures...
than
War or Natural Disaster**



Shiphrah Enterprises LLP

Plot No. 37-125/33, Sree Colony, near Helen Keller Institute, Madhura Nagar, Neredmet, Secunderabad, Telangana 500056

shiphrah.ent@gmail.com

proofex.mb@gmail.com

www.shiphrah.in